

Date: Thursday, 9/28/2006 3:48:34 PM
 User: Kim Johnston

Process Sheet

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: OH-58 FWD X-TUBE ASSEMBLY
Job Number	: 28763		
Estimate Number	: 12526		
P.O. Number	: N/A	Part Number	: D058676101
This Issue	: 9/28/2006	S.O. No.	: N/A
Prsht Rev.	: NC	Drawing Number	: D058-676-141 REV A2
First Issue	: N/A	Project Number	: N/A
Previous Run	: 28676	Drawing Revision	: A2
	Type : LANDING GEAR	Material	: N/A
Written By	:	Due Date	: 10/30/2006
Checked & Approved By	:	Qty:	1 Um: Each
Comment	: Est Rev: E 06.09.11 Reformat IEC		

Additional Product

Job Number:



Seq. #:

Machine Or Operation:

Description :

1.0

DC

DOCUMENT CONTROL



Comment: DOCUMENT CONTROL

Photocopy bluefile and create labels as per PPP D058-676-201CHG001

2.0

D6001105

Crosstube



Comment: Qty.: 1.0000 Each(s)/Unit Total: 1.0000 Each(s)

Pick:

Qty Part number Description Batch

1 D6001-105 Crosstube B23965

3.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs on both ends as per Folio FA085

2-Turn first side as per Folio FA085

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D058-676-141.

4.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

W/O:

WORK ORDER CHANGES

DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:

WORK ORDER NON-CONFORMANCE (NCR)

DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 9/28/2006 3:48:35 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY

Job Number: 28763

Part Number: D058676101

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

5.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA085

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D058-676-141. *BG 06.10.08 1*

6.0

QC1

INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

BG 06.10.08 1

7.0

QC8

SECOND CHECK



Comment: SECOND CHECK

CA 06.10.08

8.0

MORI SEIKI

MORI SEIKI CNC LATHE LARGE



Comment: MORI SEIKI CNC LATHE LARGE

1-Polish entire outside surface of crosstube

Done at Seq # 13.0 on 06-10-08 (1)

2-Remove sand and plugs

3-Scribe part # and batch # using vibrating stylus as per Dwg D058-676-141

Inside of Cuff (Do not engrave on outside of tube)

9.0

HAND FINISHING1

HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

m-h 06/12/02 (1)

10.0

QC5

INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

DP 2-1-24

11.0

BENDING

BENDING MACHINE



Comment: BENDING MACHINE

Bend tube as per Dwg D058-676-141 using CNC bender program OH58-fw and Folio FT014

DP 2-1-24

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 9/28/2006 3:48:35 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY

Job Number: 28763

Part Number: D058676101

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

12.0	QC6	DIMENSIONAL CHECK
------	-----	-------------------



Comment: Inspect dimensions and work To Current Step

07/02/05

13.0	LANDING GEAR 1	LANDING GEAR RESOURCE 1
------	----------------	-------------------------



Comment: LANDING GEAR RESOURCE 1

1-Drill pilot holes in tube as per Dwg D058-676-141 using drill Jig DT8541 & DT8542

2-Ream hole to finish size in tube as per Dwg D058-676-141 using drill Jig DT8541 & DT8542. Check dimensions between holes, both sides on both cuffs, to ensure alignment with saddle holes.

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D058-676-141

07-02-27
D/JD 7-2-28

14.0	HAND FINISHING 1	HAND FINISHING RESOURCE #1
------	------------------	----------------------------



Comment: HAND FINISHING RESOURCE #1

Chemical Conversion Coat as per QSI 005 4.1

D/JD 7-2-28

15.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

07-03-08
D.J. LPI

16.0	OUTSIDE SERVICE	OUTSIDE SERVICES
------	-----------------	------------------



Comment: Sub-Contracting OUTSIDE SERVICES

Liquid Penetrant Inspection as per QSI 0380

Issue P/O: 3270

LPI as per ASTM 1417 Level 2

Attach copy of NDT results to work order

07-03-09
U

17.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Inspect for transit damage Ensure copy of NDT results attached to work order.

07/13/05

18.0	QC6	DIMENSIONAL CHECK
------	-----	-------------------



Comment: Inspect for damage & ensure results are as per Dwg D058-676-241

07-03-15

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 9/28/2006 3:48:35 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY

Job Number: 28763

Part Number: D058676101

Job Number:



Seq. #: Machine Or Operation: Description :

19.0 SPRAY PAINTING SPRAY PAINTING



Comment: SPRAY PAINTING

1-Prime inside and outside crosstube as per QSI 005 4.2

ml 07 03 19 ①

2-Paint outside crosstube with White Imron as per QSI 005 4.2

ml 07 03 19 ①

20.0 QC14 Inspect Spray Paint



Comment: Inspect Spray Paint

Then, Wrap in plastic bag to protect from scratches

07 03 20

21.0 D2856400 Abrasion Strip



Comment: Qty.: 0.5800 f(s)/Unit Total : 0.5800 f(s)

Pick:

Qty Part number Description Batch
2 D2856-400-694 Abrasion Strip

29850

BT 07-03-21

22.0 D28911 Support 2.25 dia



Comment: Qty.: 2.0000 Each(s)/Unit Total : 2.0000 Each(s)

Pick:

Qty Part number Description Batch
2 D2891-1 Support

29086

BT 07-03-21

23.0 MS2192020 Clamp (per MIL-DTL-8783C)



Comment: Qty.: 4.0000 Each(s)/Unit Total : 4.0000 Each(s)

Pick:

Qty Part number Description Batch
4 MS21920-20 Clamp

102440

BT 07-03-21

24.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

1-Install abrasion strips as per QSI 035 using DT8579

2-Install supports and clamps as per Dwg D058-676-141. Torque clamps to 80-100 in lb.

} BT 07-03-21

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 9/28/2006 3:48:35 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY

Job Number: 28763

Part Number: D058676101

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

25.0	QC5	INSPECT WORK TO CURRENT STEP
------	-----	------------------------------



Comment: INSPECT WORK TO CURRENT STEP

Johnston

26.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1
Pick Packing Kit

27.0	AN532A	Bolt
------	--------	------



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

4 AN5-32A

Bolt

M103338 ✓

28.0	AN960JD516	Washer
------	------------	--------



Comment: Qty.: 8.0000 Each(s)/Unit Total: 8.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

8 AN960JD516

Washer

M102519 ✓

29.0	MS21042L5	Nut
------	-----------	-----



Comment: Qty.: 4.0000 Each(s)/Unit Total: 4.0000 Each(s)

Pick: Packing Kit

Qty Part number

Description Batch

4 MS21042L5

Nut (or -5)

M100564 ✓ *07/3/22* ①

30.0	QC4	INSPECT 100% KITS FOR COMPLETENESS
------	-----	------------------------------------



Comment: INSPECT 100% KITS FOR COMPLETENESS

07/13/22

31.0	PACKAGING 1	PACKAGING RESOURCE #1
------	-------------	-----------------------



Comment: PACKAGING RESOURCE #1

Identify and pack for shipping as per PPP D058-676101

Location:

REV: B *07/02/22* *SD*

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes ☐ No ☒ DQA: ☒ Date: 07/03/23

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 9/28/2006 3:48:36 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: OH-58 FWD X-TUBE ASSEMBLY

Job Number: 28763

Part Number: D058676101

Job Number:



Seq. #:

Machine Or Operation:

Description :

32.0

QC21

FINAL INSPECTION/W/O RELEASE



①

Comment: FINAL INSPECTION/W/O RELEASE

~~107/03/23~~

Job Completion



U 07-03-23

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries



DESIGN <i>CP</i>	DRAWN BY <i>CP</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>#</i>	APPROVED <i>#</i>	DRAWING NO. D058-676-141	REV. A SHEET 1 OF 3
DATE 00.11.17		TITLE CROSSTUBE ASS'Y (OH-58 HIGH FWD) NTS	
A	00.11.17	NEW ISSUE	

Qty	Part Number	Description
X	D058-676-141	CROSSTUBE ASSEMBLY (OH-58 HIGH FWD)
1	D6001-105	CROSSTUBE
2	D2856-400-694	ABRASION STRIP
2	D2891-1	SUPPORT
4	MS21920-20	CLAMP

GENERAL NOTES:

- 1) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 2) MATERIAL: MANUFACTURED FROM D6001-105
FINISHED LENGTH = 103.03±0.020
- 3) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 4) PART IS SYMMETRIC ABOUT CENTERLINE.
- 5) RUN-OFF PART. BLEND OUT EDGE LONGITUDINALLY, TRANSITION SHOULD BE SMOOTH.
- 6) MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 7) LIQUID PENETRANT INSPECT OUTSIDE SURFACE OF CROSSTUBE PER QSI 038.
- 8) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS.
- 9) INSTALL D2856-400-694 ABRASION STRIP WITH A 0.13 (REF) GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D2891-1 SUPPORT, PER QSI 035.
- 10) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE.
- 11) SEAL EDGES OF SUPPORTS AND ABRASION STRIP USING SIKAFLEX-241/291 SEALANT.
- 12) TORQUE CLAMPS 80 TO 100 IN-LB.






SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 28763

RELEASED
00.11.24 *#*

A2	01.07.16	UPDATE DIM TO FIRST HOLE	<i># CP</i>
A1	01.03.07	ADD D058-676-501 P/N	<i># CP</i>

Copyright © 2000 by DART AEROSPACE LTD

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

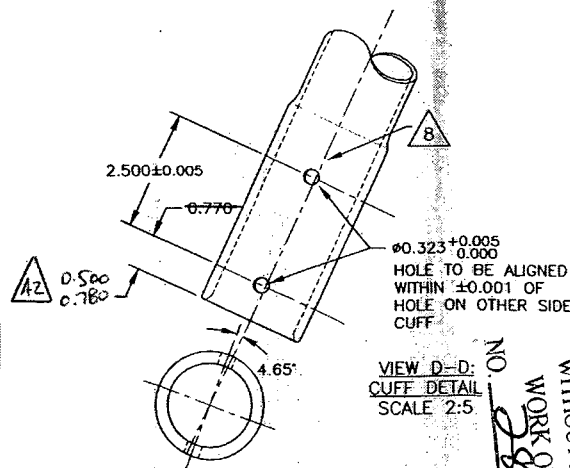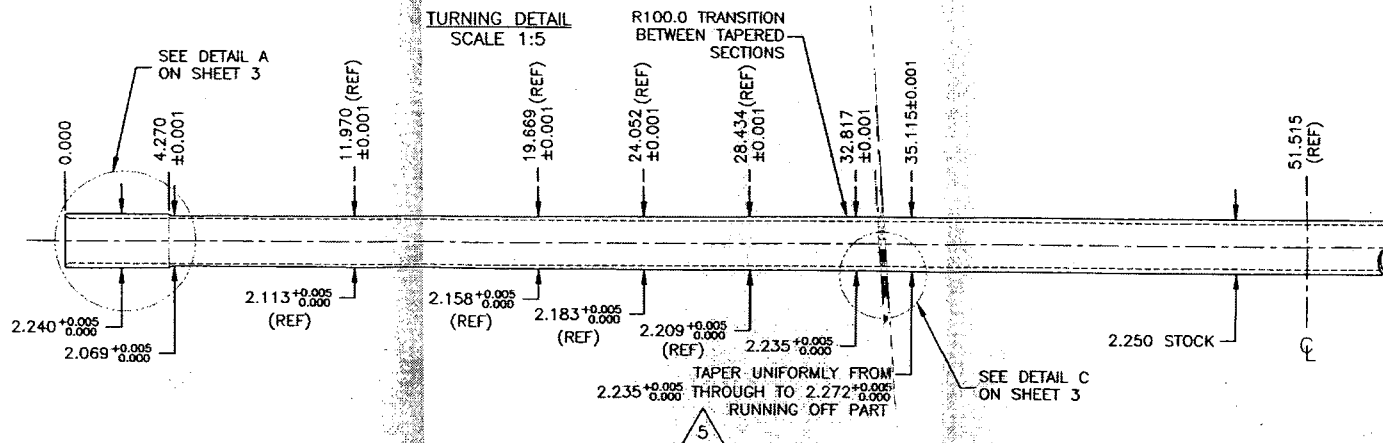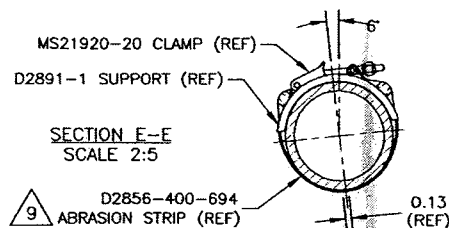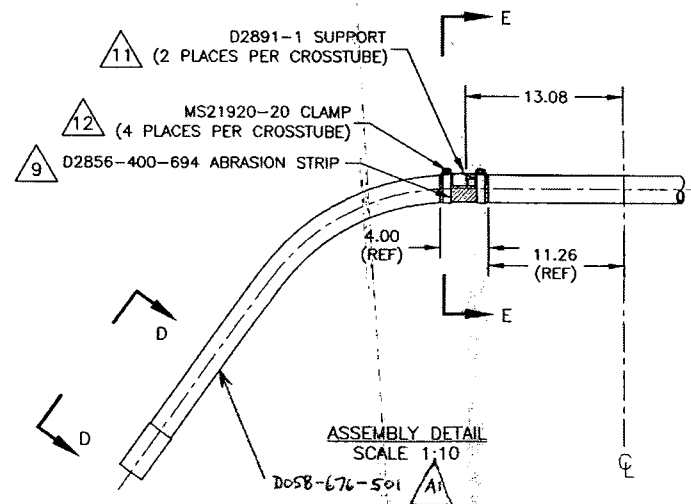
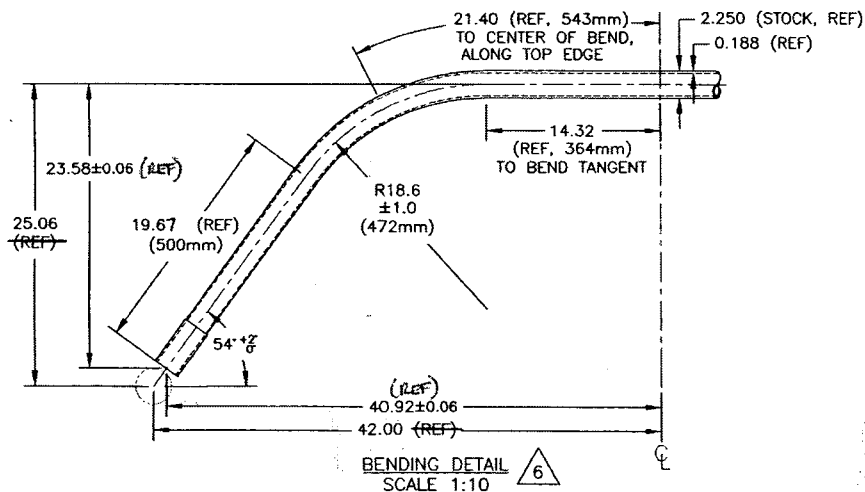


NO. 28763
WORK ORDER
WITHOUT NOTICE
SUBJECT TO AMENDMENT
UNCONTROLLED COPY
ENGINEERING
RETURN TO
SHOP COPY


RELEASED
00.11.24

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	11	DRAWN BY	DART	DART AEROSPACE LTD. WARRICKSLEY, OXFORD, GBR	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	CP	APPROVED	CP	DRAWING NO.	REV. A
		DATE	00.11.17			D058-676-141	SHEET 2 OF 3
				TITLE	CROSSTUBE ASSEMBLY (OH-58 HIGH FWD)	SCALE 1:10	

RELEASED
00.11.24

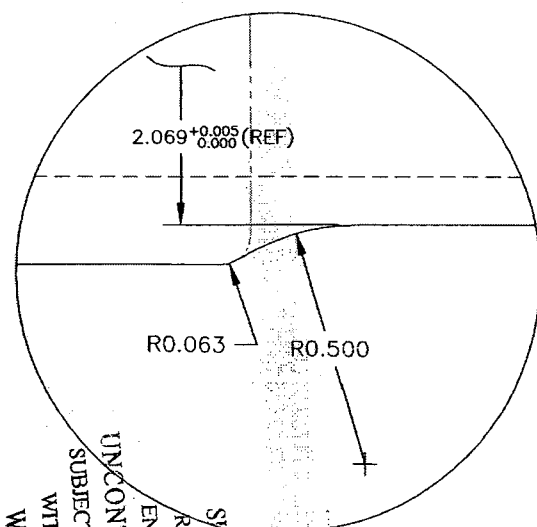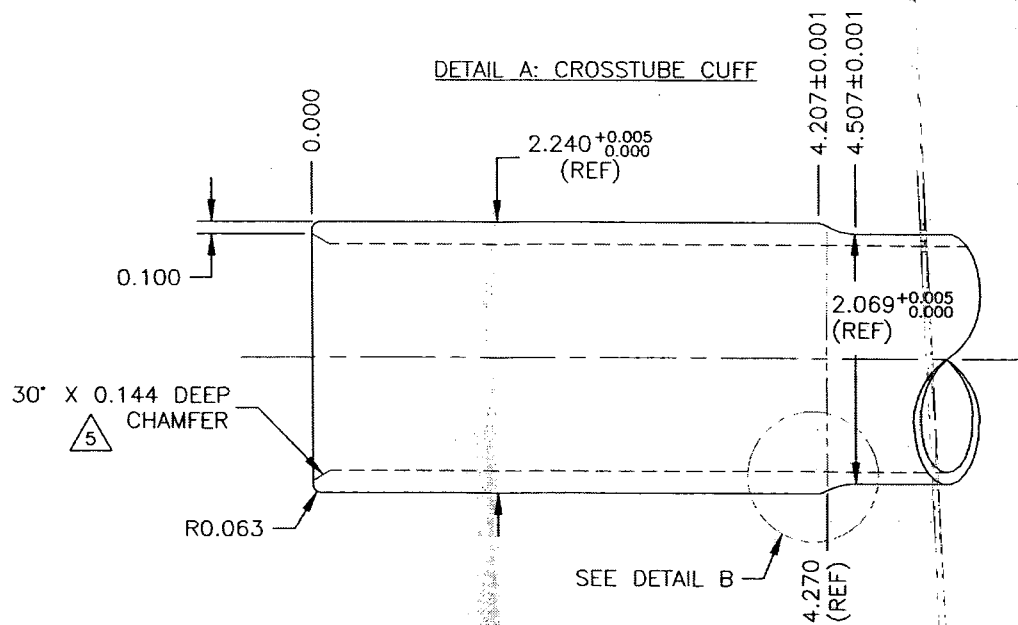

DETAIL B:
CUFF TRANSITION
SCALE 4:1

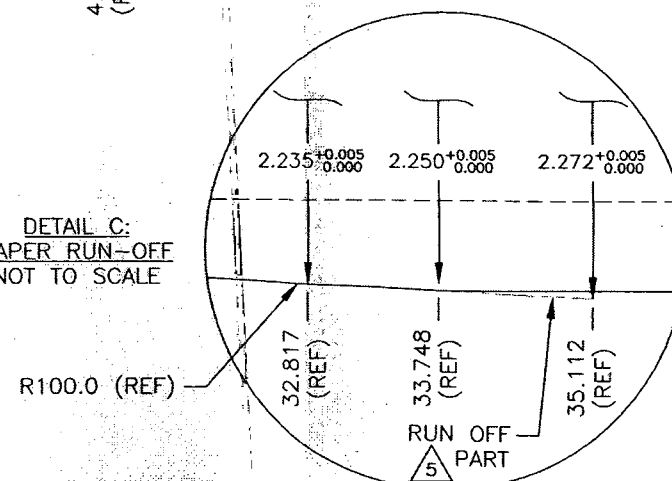

DETAIL C:
TAPER RUN-OFF
NOT TO SCALE

NO. 28763
WORK ORDER
WITHOUT NOTICE
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
RETURN TO
ENGINEERING

COPYRIGHT © 2000 BY DART AEROSPACE LTD.		DESIGN	DRAWN BY	DART	DART AEROSPACE LTD. HAMPSHIRE, ENGLAND, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	APPROVED		
		DATE		DRAWING NO.	REV. A
		00.11.17		D058-676-141	SHEET 3 OF 3
				TITLE	SCALE
				CROSSTUBE ASSEMBLY (CH-53 HIGH FWP)	1:1

DART AEROSPACE LTD		Work Order: 28763
Description: Crosstube Assembly		Part Number: 058-636-101
Inspection Dwg: 058-636-101 Rev: A		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST


☒ First Article
 ☐ Prototype

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.235	$\pm .005$	2.239	-			
	2.209	"	2.213	-			
	2.183	"	2.188	-			
	2.158	"	2.162	-			
	2.113	"	2.117	-			
	2.069	"	2.072	-			
	2.240	"	2.242	-			
	4.207	$\pm .03$	4.207	-			
	.100	$\pm .01$.100	-			
SIDE B	2.235	$\pm .005$	2.239	-			
	2.209	"	2.213	-			
	2.183	"	2.188	-			
	2.158	"	2.162	-			
	2.113	"	2.117	-			
	2.069	"	2.072	-			
	2.240	"	2.242	-			
	4.207	$\pm .03$	4.207	-			
	.100	$\pm .01$.100	-			
	103.03	$\pm .02$	103.03	-			

Measured by: 136	Audited by: SA	Prototype Approval:	N/A
Date: 06.10.08	Date: 06.10.08	Date:	N/A

Rev	Date	Change	Revised by	Approved
A		New Issue	KJ/JLM	

Crosstube Bend Dimension Sheet

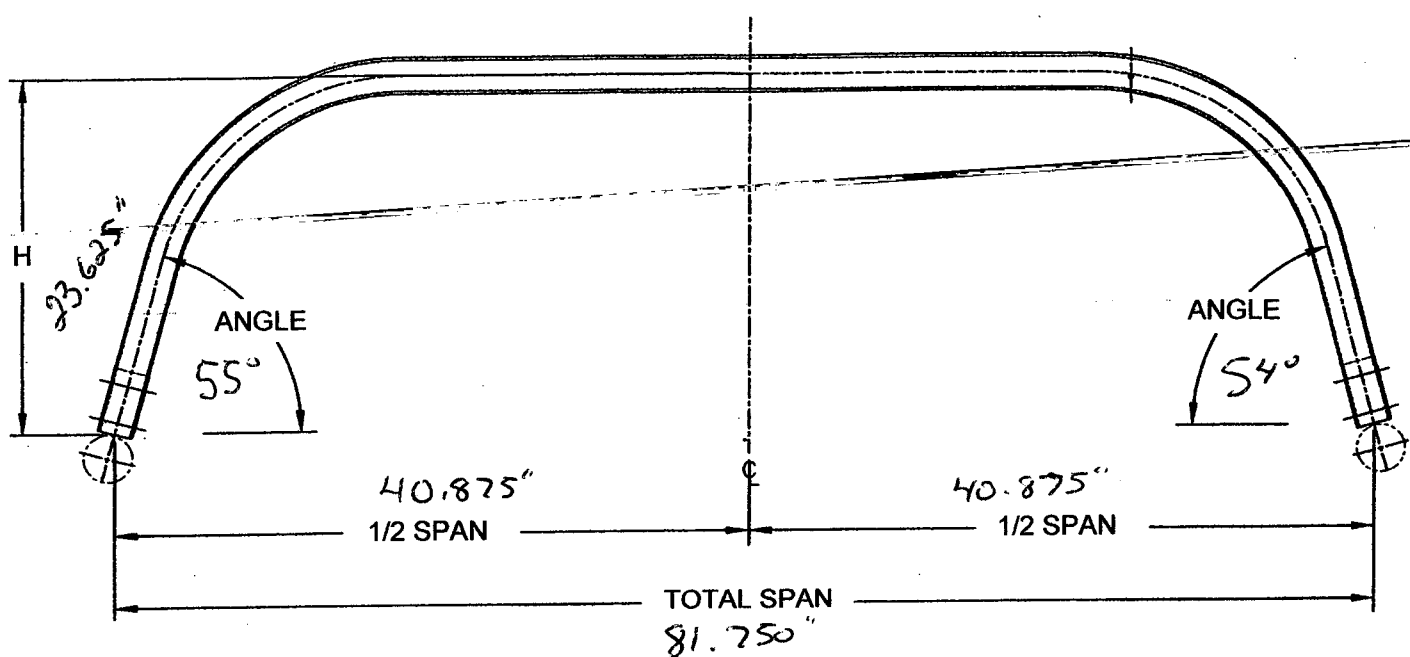

PART NUMBER: 1058-676-101

BATCH NUMBER: 28763

DRAWING: 1058-676-14 REVISION: A

H: 23.58

1/2 SPAN: 40.92

TOTAL SPAN: 81.84


ANGLE: 54

QC 15: MA

DATE: 07/02/05

QTY: (1)

Fit in table jig

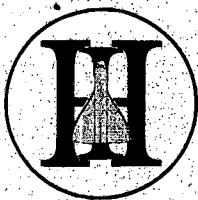

HeathAir

INTERNATIONAL (1991) INC.

681 Ave. Lepine, Dorval, Québec H9P 1G3
Tél.: (514) 636-1000 • Fax: (514) 636-0031

W.O. N° 35932

A.M.O. Number: 46/90

NON-DESTRUCTIVE TESTING REPORT

AIRCRAFT / COMPONENT INFORMATION

REGISTRATION:

MODEL/TYPE:

SERIAL NUMBER:

TOTAL HR/LDG:

OPERATED BY:

BASED AT:

INSPECTION REQUIREMENTS

Carry out FPI of (6) cross tubes (external surface) as per ASTM E-1417-05 and the Dart QSI 038, Section 4.1.1 (on file at client) - parts delivered to HeathAir.

Qty (6) P/N D058-676-101 S/N's B30218, B30217, B30219, B28767, B28763 and B30216.

☐ RADIOGRAPHY

☐ ULTRASONIC

☒ PENETRANT

☐ MAGNETIC PARTICLE

☐ EDDY CURRENT

INSPECTION REPORT

Fluorescent penetrant inspection was performed in accordance with the above requirements on (6) cross tubes.

Note: A Level 3 penetrant was substituted for the requested Level 2 (3 is more sensitive)
Ardrox 970P25E Batch #04B503.

(6) cross tubes inspected. (6) PASSED / (0) FAILED.

THE MAINTENANCE DESCRIBED ABOVE HAS BEEN PERFORMED IN ACCORDANCE WITH
THE APPLICABLE STANDARDS OF AIRWORTHINESS

INSPECTED BY:

DATE March 09, 2007

INSPECTION
STAMP(S)

CUSTOMER INFORMATION

CUSTOMER: Dart Aerospace

P.O. NUMBER PO 00003270

ADDRESS:

CONTACT NAME: Linda Lacelle

LABOUR

@

\$

MATERIALS

@

TRAVEL EXPENSES

@

GST

HOTEL EXPENSES

@

PST

INVOICE NO.

TOTAL \$

WHITE COPY - INSPECTION FILE • YELLOW COPY - CUSTOMER • PINK COPY - ACCOUNTANT